

Invoice

Date	
Thursday, December	er 19, 2024
Invoice No.	81195

1956 Mercury Montclair 0

Labor Rates: Body \$95.00 Paint \$95.00 Trim \$95.00 Mech \$9	Partsi	Laborriot					
Description	Materials	Body	Paint	Trim	Mech	Fab	
			-			_	
Perform Mechanical Checklist inspection							
Research & source parts Estimate repairs			-				
Particular Particular	130.00						
Re-charge & test battery Failed	182.00						
Remove & replace battery	102.00						
Check charging system Failed Remove & replace voltage regulator & re-test Passed	84.50						
Remove & replace voltage regulator & re-test 1 assess Remove & replace (4) wheel cylinders	130.00						
Clean & re-pack front wheel bearings	100.00						
Remove & replace power brake booster & master cylinder	1560.00						
Bleed & adjust brake system Re-fill brake fluid	13.00						
Remove & replace inner & outer tie rods & sleeves (kit)	227.50						
Remove & replace idler arm & bushings	240.50						
Mount & balance 4 new Coker Classic WW radial tires	1365.00						
Check / adjust alignment							
Inspection revealed rear axle needs to be repaired / rebuilt							
Remove rear axle for outsourced repair							
Unable to obtain replacement parts for repair							
Weld 3rd member pin in carrier							
Remove & replace rear axle seals							
Re-install 3rd member & rear axle assembly							
Re-fill rear axle gear oil	52.00						
Found carburetor leaking fuel							
Remove & dis-assemble carburetor							
Replace fuel inlet o-rings	10.40						
Re-assemble & re-test Passed							
Light check							
Remove & replace headlight bulb	23.40						
Remove & replace back up light bulb	3.90					,	
Fluid check							
			<u> </u>		77.00		
Total mechanical labor hours					77.00		
				-			
			-				
	.						
Note: Body to frame mount structure is (rusted out) compromised							
Total Labor Hours		10.00		0.00	77.00	DE DIE	
Labor Rate per Hour		\$ 95.00	\$ 95.00		\$ 95.00	\$ 95.0	
	\$ 4,022.20	\$ -	\$ -	\$ -	\$ 7,315.00	\$ -	
NV TEXT IS ASSESSED AS INCLUDED THE WAS A SECOND OF THE WAY	\$ -						
	\$ -						
	\$ -					Post Circles	
Total Outsourced Work	\$ -	THING TAIL S			DOMEST.	E WAY	
Remittance Address: 24331 Brest Road Taylor, MI 48180					0.1003	4 000 0	
Ph: (734) 947-7002 Fax: (734) 947-2551	Materials su				\$	4,022.2	
Email: vendor@mcshotrod.com	Labor subto	al			\$	7,315.0	
Motor Vehicle Registration No: F165288	Shop supplies				\$	30.0	
All Repairs Properly Performed P.A. 300	Outsourced	work			\$		

Page 1 of 2

	Parts/ Lab			abor Hours	LL DAS SU	1 3 0 0 00	
Description	Materials	Body	Paint	Trim	Mech	Fab	
	Shipping fees		THE PARTY OF		\$	115.00	
	Transport veh		\$	250.00			
22	SUBTOTAL		\$	11,732.20			
X	MI sales tax (a 6%			\$	250.03	
Mechanic's Name & MI Certification No. Scott Dronsella #M202111 Rick Carpenter #M273182	TOTAL JOB		40, 22, 44	1 4	\$	11,982.23	
	Payments/Cre		\$	(41)			
	Approximate the party of the pa				\$		
	BALANCE D	UE			\$	11,982.23	



EDL Services LLC

Antique / Classic Car Repair 1135 Badder Ave. Troy, MI 48083 (248) 797-8781

Make of Car

1956 Mercury Montclair

Invoice #3496

		Cost of		
		Parts	Quantity	AMOUNT
2/2/2024	Electric Fuel Pump	195.00	1	195.00
2/2/2024	Fuel Sending Unit	86.09	1	86.09
Ol as Bata	Brake Fluid	13.08	0.5	6.54
Close Date	Transmission Fluid	12.75	1	12.75
4/10/2024	Generator V-Drive Belt	36.51	1	36.51
	Power Steering Pump Rebuild Kit	62.52	1	62.52
	Air Filter	18.54	1	18.54
	Mechanical Fuel Pump	209.48	1	209.48
	IMechanicar Fuel Fump	0.00	1	0.00
		0.00	1	0.00
		0.00	1	0.00
		0.00	1	0.00
		0.00	i	0.00
	Cabon	0.00	•	
	Other:	0.00	1	0.00
		0.00	i	0.00
		0.00	•	****
	Chan Cumplion		3%	191.40
	Shop Supplies			
	Labor Rate	110.00	58	6380.00
	Machining Rate	125.00	0	0.00
	Washing Hate	OTHER		0.00
		PARTS		\$627.42
		LABOR		\$6,571.40
		TAX	\$	37.65_
			-	
1				
		TOTAL AMOUNT I	DUE:	\$7,236.47
			· ·	

EDL SERVICES, LLC

DATE	BODY SHOP - DESCRIPTION	HOURS
2/12	Installed new mechanical fuel pump, test no fuel getting to the carburetor. Remove all fuel lines leading from the gas tank. Inspect and blow compressed air through lines plugged up solid. Inspect junction	6
2/13	block for fuel lines cannot pass compressed air through. Removed all fuel lines to gas tank. Drained gas tank fully. Remove gas tank, remove sending unit, bench test sending unit, wire up sending unit to car while gas tank outside of car sending unit works. Made new gasket for sending unit and reinstalled in gas tank. Clear fuel lines fully and reinstalled in car.	7
2/14	Troubleshooting mechanical fuel pump, would not pump fuel to carburetor.	7
2/15	Modified existing fuel lines and began installing a new electric fuel pump. Mounted electric fuel pump, modified fuel hard line, added soft fuel line from	6
2/16	the electric fuel pump to the gas tank. Installed new fuel filter in sending unit Ran wiring to the electric fuel pump. Test electric fuel pump works great.	7.5
	Checked fuel system for possible leaks no leaks, all good. Resolved oil leak at the oil filter. Re-route electrical line for the oil pressure sending unit. Replaced oil filter. Tightened main oil fitting at the oil pan. Check brake lights not working. Test brake pressure switch not working, replaced with new one. Brake lights, turn signals, running lights, headlights, and dash	
2/23	lights all work. Check brake fluid, topped off to fill level. Test drive leaking power steering pump observed. Advise remove and rebuild to re-seal. Check transmission fluid, added 1/2 quart. Adjusted points and tested ignition coil	7
2/26	works fine. File points in distributor. Found loose connection to the ballast resistor in	7
2/27	distributor, replaced connection. Install new sending unit in gas tank. Install battery hold down. Removed old electric fuel pump no longer functioning. Plug existing mounting holes left behind from electric fuel pump.	3
0.15	Replace electrical connection to ignition coil. Air up all 4 tires.	1
3/5 3/29	Replace fuel sending unit. Test run sending unit works. Removed power steering pump. Disassembled and fully cleaned. Rebuilt	3
4/1	with new gaskets and rings from rebuild kit. Recondition and reconnect the ground and positive wires from the	1.5
	generator.	2
4/10	Reinstall power steering pump. Replace generator V-belt. Install new air filter.	
	Total Hours	58

Extrusion Punch & Tool

INVOICE

1977 Rochester Industrial Drive Rochester Hills, MI 48309 Phone 248.689.3300 Fax 248.689.6307 **DATE:** October 29, 2021 **INVOICE #** I-16192

Bill To:

Invoice is for 1956 Mercury Montclair not 1955. Submitted in SAS with comment. DP 11/2/2021

DESCRIPTION	AMOUNT
Repairs made to 195 Mercury Montclair	
Recore the old heater core. Repaint ducting and components stained by leak	600.00
Parts \$300, Labor \$300	
Fix lights, remove and clean headlight switch. Horn and wipers work properly. Labor	125.00
Fix license plate remote light.	50.00
Flush cooling system twice. New antifreeze.	225.00
Parts \$100, Labor \$125	
Gasoline, car ran out of gas	100.00
Clean carpeting and fully dry out	125.00
Parts \$25.00, Labor \$100	
New Jute pad under passenger carpet area. Original was soaked with coolant	30.00
Car would not start cold without squirting gas into carb. Labor	400.00
Choke locked up and not able to move at all. Removed, disassembled and cleaned.	
Repaired passenger door handle. Disassembled door to access missing screw. Labor	100.00
Undercoated front wheel wells to hide orange/white paint overspray.	35.00
Parts \$15, Labor \$20	
Passenger side headlamp burned out. Replaced both bulbs with better halogen	100.00
replacement. Parts	
Acid washed firewall and fenderwall to remove stains from leaking heater core. Parts.	35.00
Replace upper radiator hose. Lower hose and heater hoses are ok	70.00
Parts \$35, Labor \$35	
Fuel pump not working the next day after hot drive. Corrosion and one-way valves stuck.	300.00
Diaghram cracked and warped due to sitting and drying out	
Parts \$250, Labor \$50	
Added transmission fluid Type F. Excludes transmission fluid leak that's going to require	40.00
service	
TOTAL	\$ 2,335.00

Extrusion Punch & Tool

INVOICE

1977 Rochester Industrial Drive Rochester Hills, MI 48309 Phone 248.689.3300 Fax 248.689.6307

DATE: November 23, 2021 INVOICE # I-16216

DESCRIPTION	A	MOUNT
1956 Mercury Montclair transmission repair	\$	1,676.70
TOTAL	\$	1,676.70

TRANSMISSIONS UNLIMITED, INC.

4327 AUBURN ROAD

SHELBY TWP, MI. 48317-4007

INVOICE 20481

Phone: 586-731-3962 Fax: 586-731-6785

MICHIGAN REGISTRATION:

FAC# 105038

Proposed completion date:

11/22/2021

Printed Date: 11/23/2021

Work Completed:

11/22/2021

1956 Mercury - Montclair -

Lic #: 078098 - MI

Unit #: Orange/ White

VIN#:

Odometer In: 20075

				V II V III .		
Part Description / Number	Qty	Sale	Ext	Labor Description	Hours	Extended
KIT, OVERHAUL 1951-57 K6900V	1.00	193.00	193.00	FOR A TRANS LEAK.	12.00	1,200.00
BUSHING, FRONT PUMP 6010	1.00	28.00	28.00	11/18/2021: GREG OK'D A REBUILD OF A (MEDIUM CASE) TRANSMISSION. ESTI PARTS AND LABOR. CUSTOMER'S DAT	MATE \$1800	-2200 FOR
BUSHING, EXTENSION HOUSING 1.5" LONG 6014	1.00	24.50	24.50	12/08/1955. Hazardous Materials Handling		5.00
BUSHING, CASE 6016	1.00	35.00	35.00			
FRICTION, FRONT CLUTCH 1951-57 6204G	4.00	13.00	52.00			
STEEL, FRONT CLUTCH 1951-57 6205	3.00	12.00	36.00			
(QT) ATF, DEXRON III	11.00	6.50	71.50			

5.00

Original Estimate Amount:

EPA/Shop Supplies

INVOICE

0.00

YOU ARE ENTITLED BY LAW TO THE RETURN OF ALL PARTS REPLACED EXCEPT THOSE WHICH ARE TOO HEAVY OR LARGE, AND THOSE REQUIRED TO BE SENT BACK TO THE MANUFACTUER OR DISTRIBUTOR BECAUSE WARRANTY WORK OR AN EXCHANGE AGREEMENT. YOU ARE ENTITLED TO INSPECT THE PARTS WHICH CANNOT BE RETURNED TO YOU.

Discard Signature Save I hereby authorize the above repair work to be done along with the necessary materials, and hereby grant you and/or your employee permission to operate the car, truck or vehicle herein described on streets; highways or elsewhere for the purpose of testing and/or inspection. An express rechange's lien is hereby acknowledged on above car, truck or vehicle to secure the

amount of repairs thereto. X Estimated Increased Total: ...

Mechanic's Name & Michigan Certification Number

WALTERS, CHARLES M103607; MILLER, STEVEN M135911

Authorized by:

-CERTIFICATION-ALL REPAIRS AND PARTS LISTED WERE FURNISHED IN COMPLIANCE WITH THE MICHIGAN AUTO REPAIR ACT (P.A. 300) ALL PARTS ARE NEW UNLESS OTHERWISE STATED.

ALL REPAIRS PROPERLY COMPLETED

445.00 Parts: 0.00 Sublet: 1,645.00 Sub: 5.00 HazMat:

Labor:

1,200.00

26.70 Tax: \$1,676.70 Total: \$0.00 **Bal Due:**

Repairs Performed by: