


Brian Crall Company Inc.

2105 RR620 S #105 Lakeway Texas 78734 512-294-9650

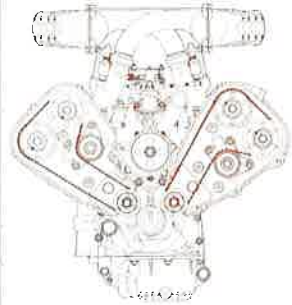

Invoice #	229	Make	Ferrari	Year	1986
Date	9/15/21	Model	328 GTB	VIN	ZFFXA19A2G0064291
Name	Kevin			Assy. #	23
Address				Miles	59451
Phone	512-██████████			License	██████████

Labor Operations	Amount
-------------------------	---------------

Major service per Ferrari specifications inc belts, tensioners, fluids & filters (note: customer supplied filters, tensioners)	\$4,800.00
--	------------

Replace heater system supply hose. It is disconnected. Inspected hose and it was early material and rotten full length. It was stuck and required moving fuel tank to replace. Turns out fuel tank had been removed before and on reinstallation hose was incorrectly located and got crushed between tank and body of car.

Return hose was rotten as well and pipe nipple it is attached to was badly deformed from overtightening of hose clamp. Repair nipple and replace hose.

	10 hrs.	\$1,500.00
--	---------	------------

Replace cracked strut bushing at rear valve cover.	\$150.00
Replace broken oil cooler mounts.	N/C
Reseal both oil pans and shift shaft seals.	\$750.00
Replace oil return hose at rear head.	N/C
Replace fuel pump feed hose and fuel cross over pipe hoses.	\$150.00
Service front wheel bearings.	\$700.00
Convert AC to R12. Requires change fittings and flush system including wash out compressor.	\$300.00
Repair alternator cooler hose.	N/C
Install fog light protection	N/C
Replace damaged transaxle fill plug.	N/C

I hereby authorize the above work to be done along with the necessary material and hereby grant you and or your employees permission to operate the vehicle herein described for the purpose of testing and or inspection. An express mechanics lien is hereby acknowledged on this vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to the vehicle or items

left in vehicle in case of fire or theft or any other cause beyond our control.

Signed X

Parts	
Sublet	
Labor	\$8,350.00

Ferrari technical service bulletins # 1003, 1003/A and # 1215 dictate replacement intervals for timing belts. If your car is equipped with timing belts, ask for details.

Tax	
Total	See last page

2105 RR620 S #105 Lakeway Texas 78734 512-294-9650					
Invoice #	229	Make	Ferrari	Year	1986
Date	9/15/21	Model	328 GTB	VIN	ZFFXA19A2G0064291
Name	Kevin			Assy. #	23
Address				Miles	59451
Phone				License	
Labor Operations				Amount	
Lug bolts looked like they were dipped in antisieze. They should not have lubrication. Clean all bolts and threads in all 4 hubs.				\$150.00	
Hose 122218 from coolant tank to head crossover pipe was replaced with fuel line. As a result it is brittle and cracked when removed from tank for servicing. Replace hose. Required removal of injector lines and plenum chamber.				\$300.00	
When plenum chamber was removed I found some fasteners missing, chamber was loose with badly distorted rubber gaskets and had vacuum leaks. Order and install new rubber gaskets and replace missing fasteners. Found special cone lock washers were not used. Dig through special fastener collection to find correct hardware .				\$250.00	
Warm up regulator loose in its mounts. Was missing 103550 spacers and washers. Fabricate and install spacers and replace missing washers.				\$75.00	
Perform 3 FNA suggested modifications to reduce chances of oil leakage from heads. In all these years it has never been done.				\$150.00	
I hearby authorize the above work to be done along with the necessary material and hereby grant you and or your employees permission to operate the vehicle herein described fot the purpose of testing and or inspection. An express mechanics lien is hereby acknowledged on this vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to the vehicle or items left in vehicle in case of fire or theft or any other cause beyond our control.					
Signed X				Parts	
				Sublet	
				Labor	
				\$925.00	
Ferrari technical service bulletins # 1003, 1003/A and # 1215 dictate replacement intervals for timing belts. If your car is equipped with timing belts, ask for details.				Tax	
				Total	
				See last page	

Invoice #	229	Make	Ferrari	Year	1986
Date	9/15/21	Model	328 GTB	VIN	ZFFXA19A2G0064291
Name	Kevin			Assy. #	23
Address				Miles	59451
Phone				License	

Lug bolts looked like they were dipped in antisieze. They should not have lubrication. Clean all bolts and threads in all 4 hubs.		\$150.00
---	--	----------

Hose 122218 from coolant tank to head crossover pipe was replaced with fuel line. As a result it is brittle and cracked when removed from tank for servicing. Replace hose. Required removal of injector lines and plenum chamber.		\$300.00
---	--	----------

When plenum chamber was removed I found some fasteners missing, chamber was loose with badly distorted rubber gaskets and had vacuum leaks. Order and install new rubber gaskets and replace missing fasteners. Found special cone lock washers were not used. Dig through special fastener collection to find correct hardware .		
		\$250.00

Warm up regulator loose in its mounts. Was missing 103550 spacers and washers. Fabricate and install spacers and replace missing washers.		\$75.00
---	--	---------

[illegible]

I hereby authorize the above work to be done along with the necessary material and hereby grant you and or your employees permission to operate the vehicle herein described for the purpose of testing and or inspection. An express mechanics lien is hereby acknowledged on this vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to the vehicle or items		
--	--	--

left in vehicle in case of fire or theft or any other cause beyond our control.				Parts	
Signed X				Sublet	
				Labor	\$925.00

Ferrari technical service bulletins # 1003, 1003/A and # 1215 dictate replacement intervals for timing belts. If your car is equipped with timing belts, ask for details.	Tax	
	Total	See last page

Brian Crall Company Inc.


2105 RR620 S #105 Lakeway Texas 78734 512-294-9650



Invoice #	229	Make	Ferrari	Year	1986
Date	9/15/21	Model	328 GTB	VIN	ZFFXA19A2G0064291
Name	Kevin			Assy. #	23
Address				Miles	59451
Phone	512-			License	
Labor Operations					Amount
Torque strut mounting bracket loose and spacers missing.					N/C
Car has fuel injection warm up regulator for European version.					
Correct part N/A.					N/C
Replace water pump.					\$150.00
Replace front crank seal					\$300.00
Replace plug connectors and test wires. Wires NG. Replace.					\$300.00
Right coolant pipe support bracket broken off and mostly missing so I made and installed an insulator to prevent damage to pipe from fuel tank mounting strap.					\$50.00
Replace cold running air supply hose. Hose used was coolant hose and not suitable.					\$35.00
Sublet		Description			Amount
Shipping		FedEx			\$65.00
I hereby authorize the above work to be done along with the necessary material and hereby grant you and or your employees permission to operate the vehicle herein described for the purpose of testing and or inspection. An express mechanics lien is hereby acknowledged on this vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to the vehicle or items left in vehicle in case of fire or theft or any other cause beyond our control.					
Signed X				Parts	
				Sublet	\$65.00
				Labor	\$835.00
Ferrari technical service bulletins # 1003, 1003/A and # 1215 dictate replacement intervals for timing belts. If your car is equipped with timing belts, ask for details.				Tax	
				Total	See last page

Brian Crall Company Inc.

2105 RR620 S #105 Lakeway Texas 78734 512-294-9650

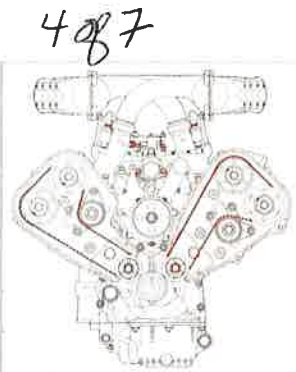

Invoice #	229	Make	Ferrari	Year	1986
Date	9/15/21	Model	328 GTB	VIN	ZFFXA19A2G0064291
Name	Kevin			Assy. #	23
Address				Miles	59451
Phone	512-468-1404			License	

Labor Operations	Amount
Remove, ultrasonically clean and test injection nozzles.	Incl.
Replace large coolant hose from tank to pipe.	Incl.
Remove clean and test throttle switch	Incl.
Replace rusty air injection check valves.	Incl.

I hereby authorize the above work to be done along with the necessary material and hereby grant you and or your employees permission to operate the vehicle herein described for the purpose of testing and or inspection. An express mechanics lien is hereby acknowledged on this vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to the vehicle or items

left in vehicle in case of fire or theft or any other cause beyond our control.

Signed X

Parts

Sublet

Labor

N/C

Ferrari technical service bulletins # 1003, 1003/A and # 1215 dictate replacement intervals for timing belts. If your car is equipped with timing belts, ask for details.


Tax

Total

See last page

Brian Crall Company Inc.

2105 RR620 S #105 Lakeway Texas 78734 512-294-9650

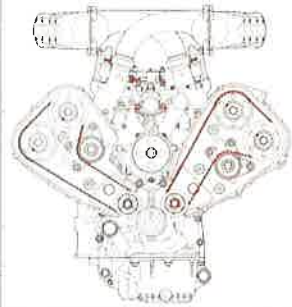

Invoice #	229	Make	Ferrari	Year	1986
Date	9/15/21	Model	328 GTB	VIN	ZFFXA19A2G0064291
Name	Kevin			Assy. #	23
Address				Miles	59451
Phone	512-			License	
Part #		Description		Qty.	Amount
116777	Aeroquip	Fuel hose		1	\$30.00
109354	Aeroquip	Fuel hose		1	\$44.00
119281	Earls	Fuel hose		1	\$82.00
118216	Aeroquip	Oil hose		1	\$28.00
127172	Gates	Heater hose		1	\$40.00
109755	Gates	Heater hose		1	\$15.00
NPN	Materials for cleaning and repacking front wheel bearings				\$25.00
NPN		1 inch Adel clamp		1	\$1.50
12-20	Norma	Hose clamp		1	\$2.50
122218	Gates	Coolant hose		1	\$8.00
126699		Plug extender		8	\$240.00
114983		Intake gasket		4	\$120.00
121655		WP belt		1	\$69.00
108224		Seal		1	\$26.88
121255		Water pump		1	\$425.00
105196		O ring		1	\$4.40
121788		Plug wire clip		4	\$49.40
121790		Plug wire clip		2	\$23.00
NPN		Schrader valve		2	\$2.00
NPN		A/C O ring		4	\$3.00
NPN		Service port cap		2	\$2.00
NPN		AC flush			\$12.00
NPN		A/C oil			\$5.00
105039		A/C shim		1	\$15.23

I hereby authorize the above work to be done along with the necessary material and hereby grant you and or your employees permission to operate the vehicle herein described for the purpose of testing and or inspection. An express mechanics lien is hereby acknowledged on this vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to the vehicle or items

left in vehicle in case of fire or theft or any other cause beyond our control.

Signed X

Parts \$1,272.91

Sublet

Labor

Ferrari technical service bulletins # 1003, 1003/A and # 1215 dictate replacement intervals for timing belts. If your car is equipped with timing belts, ask for details.


Tax

Total

See last page

Brian Crall Company Inc.

2105 RR620 S #105 Lakeway Texas 78734 512-294-9650

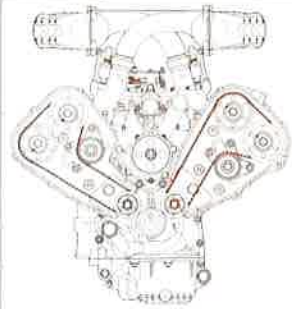

Invoice #	229	Make	Ferrari	Year	1986
Date	9/15/21	Model	328 GTB	VIN	ZFFXA19A2G0064291
Name	Kevin			Assy. #	23
Address				Miles	59451
Phone	512-			License	
Part #		Description		Qty.	Amount
108741		Wiper blade		2	\$38.00
121769		Air inj. ck. Valve		2	\$80.00
150198		Gasket		1	\$18.35
121789		Plug wire clip		2	\$19.50
150078		Valve cover gasket		1	\$89.95
132453		Distributor seal		2	\$39.80
151342		Gasket		1	\$3.82
147675		Gasket		1	\$24.95
147676		Gasket		1	\$24.95
115372		Seal		2	\$49.90
106418		Bushing		1	\$91.39
101468		Fuel hose		2	\$188.70
102947		Mount		4	\$60.00
150084		Valve cover gasket		1	\$89.95
163987		Cam seal		4	\$60.00
117275		O ring		4	\$22.80
150075		Gasket		1	\$9.89
111334		Timing belt		2	\$40.50
121655		WP belt		1	\$69.47
150198		Gasket		2	\$36.70
130498		Alt belt		1	\$13.44
10261860		Drain plug seal		3	\$4.50
10257060		Drain plug seal		1	\$1.00
DR7EIX	NGK	Spark plugs		8	\$76.00

I hereby authorize the above work to be done along with the necessary material and hereby grant you and or your employees permission to operate the vehicle herein described for the purpose of testing and or inspection. An express mechanics lien is hereby acknowledged on this vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to the vehicle or items

left in vehicle in case of fire or theft or any other cause beyond our control.

Signed X

Parts \$1,153.56

Sublet

Labor

Ferrari technical service bulletins # 1003, 1003/A and # 1215 dictate replacement intervals for timing belts. If your car is equipped with timing belts, ask for details.


Tax

Total

See last page

Brian Crall Company Inc.

2105 RR620 S #105 Lakeway Texas 78734 512-294-9650

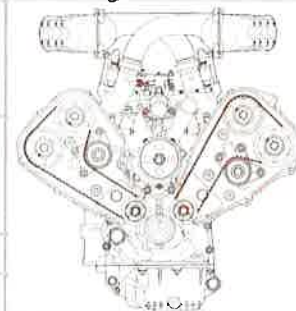

Invoice #	229	Make	Ferrari	Year	1986
Date	9/15/21	Model	328 GTB	VIN	ZFFXA19A2G0064291
Name	Kevin			Assy. #	23
Address				Miles	59451
Phone	512-			License	
Part #		Description		Qty.	Amount
107835		A/C shim		3	\$34.89
10977711		Screw		10	\$7.00
60793500		Washer		10	\$3.00
12575621		Nut		4	\$3.60
107993		Washer		4	\$2.00
10275011		Drain plug		1	\$2.11
10261860		Drain plug seal		1	\$1.50
Redline 75w90		Gear oil		9	\$117.00
R12		Freon	Kg	1	\$135.00
135118		Intake hose		1	\$29.00
11198071		8mm cone washer		8	\$8.00
16100811		Nut		1	\$0.75
113570		Injector seal		8	\$43.20
FER9913		Wire set		1	\$495.00
115418		Pipe clamp		2	\$12.00
11270160		Fuel line seal		3	\$3.00
14330260		Fuel line seal		8	\$7.20
10260160		Fuel line seal		20	\$17.00
Rotella ELCNF Shell		Coolant		3	\$45.00
122221		Hose		1	\$12.00
NPN		Parts cleaner		4	\$24.00
0w40	Mobile 1	Motor oil		10	\$100.00
DOT4	Brembo	Brake fluid		1	\$25.00

I hereby authorize the above work to be done along with the necessary material and hereby grant you and or your employees permission to operate the vehicle herein described for the purpose of testing and or inspection. An express mechanics lien is hereby acknowledged on this vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to the vehicle or items

left in vehicle in case of fire or theft or any other cause beyond our control.

Signed X

Ferrari technical service bulletins # 1003, 1003/A and # 1215 dictate replacement intervals for timing belts. If your car is equipped with timing belts, ask for details.

Parts	\$3,553.72
Sublet	\$65.00
Labor	\$10,110.00
Tax	\$293.19
Total	\$14,021.91